

084704

ORNL/RASA-90/7

ornl

**OAK RIDGE
NATIONAL
LABORATORY**

MARTIN MARIETTA

**RESULTS OF MOBILE GAMMA
SCANNING ACTIVITIES IN
ST. LOUIS, MISSOURI**

R. E. Rodriguez
D. A. Witt
W. D. Cottrell
R. F. Carrier

MANAGED BY
MARTIN MARIETTA ENERGY SYSTEMS, INC.
FOR THE UNITED STATES
DEPARTMENT OF ENERGY

084704

SL-097

ORNL/RASA-90/7

HEALTH AND SAFETY RESEARCH DIVISION

Environmental Restoration and Waste Management Non-Defense Programs
(Activity No. EX 20 20 01 0; ADS3170000)

**RESULTS OF MOBILE GAMMA SCANNING ACTIVITIES
IN ST. LOUIS, MISSOURI**

R. E. Rodriguez, D. A. Witt,
W. D. Cottrell, and R. F. Carrier

Date published — June 1991

Investigation Team

R. E. Swaja — Measurement Applications and Development Manager
W. D. Cottrell — FUSRAP Project Director

Survey Team Members

R. L. Coleman R. E. Rodriguez
W. D. Cottrell S. J. Wallace
D. A. Witt

Work performed by the
MEASUREMENT APPLICATIONS AND DEVELOPMENT GROUP

Prepared by the
OAK RIDGE NATIONAL LABORATORY
Oak Ridge, Tennessee 37831-6285
managed by
MARTIN MARIETTA ENERGY SYSTEMS, INC.
for the
U. S. DEPARTMENT OF ENERGY
under contract DE-AC05-84OR21400

CONTENTS

LIST OF FIGURES	v
ACKNOWLEDGMENTS.....	vii
ABSTRACT.....	ix
INTRODUCTION.....	1
SURVEY METHODS	2
MOBILE SCANNING METHOD.....	2
INSTRUMENTATION	2
DETECTOR SENSITIVITY.....	3
SURVEY RESULTS.....	4
SIGNIFICANCE OF FINDINGS	4
REFERENCES.....	5

LIST OF FIGURES

- 1 General location of the Mallinckrodt Chemical Plant and the SLAPS, HISS, and West Lake Landfill storage sites, St. Louis, Missouri6
- 2 Diagram of route scanned in the vicinity of the Mallinckrodt Chemical Plant site, St. Louis, Missouri7
- 3 Diagram of routes scanned by ORNL and routes characterized by BNI in the vicinity of the Lambert-St. Louis International Airport, St. Louis, Missouri8

ACKNOWLEDGMENTS

Research for this project was sponsored by the U. S. Department of Energy's Office of Environmental Restoration, under contract DE-AC05-84OR21400 with Martin Marietta Energy Systems, Inc. The authors gratefully acknowledge the assistance of the following members of Oak Ridge National Laboratory (ORNL): M. S. Blair of the Instrumentation and Controls Division; R. L. Coleman and T. A. Stewart of the Measurement Applications and Development Group, and S. J. Wallace of the Pollutant Assessments Group. The contributions of these individuals to the collection, analysis, and recording of data for this survey and to the preparation of graphics made this report possible.

ABSTRACT

From 1942 through approximately 1966, the Mallinckrodt Chemical Works operated four plants in St. Louis, Missouri, for the Manhattan Engineer District (MED) and the Atomic Energy Commission (AEC). A variety of production processes using uranium- and radium-bearing ore materials were performed at the plants. It is the policy of the U. S. Department of Energy (DOE) to verify that radiological conditions at such sites or facilities comply with current DOE guidelines. Guidelines for release and use of such sites have become more stringent as research has provided more information since previous cleanups. The Formerly Utilized Sites Remedial Action Program (FUSRAP) was established as part of that effort to confirm the closeout status of facilities under contract to agencies preceding DOE during early nuclear energy development.

Under the FUSRAP program, the Mallinckrodt properties have been previously investigated to determine the extent of on-site radiological contamination. At the request of DOE, Oak Ridge National Laboratory (ORNL) conducted a survey in May, 1990, of public roadways and suspected haul routes between the Mallinckrodt plant and storage sites in St. Louis to ensure that no residual radioactive materials were conveyed off-site. A mobile gamma scanning van with an on-board computer system was used to identify possible anomalies. Suspect areas are those displaying measurements deviating from gamma exposure rates identified as typical for radiologically un-enhanced areas in the vicinity of the areas of interest.

The instrumentation highlighted three anomaly locations each of which measured less than 1 m² in size. None of the slightly elevated radiation levels originated from material associated with former AEC-related processing operations in the area. The anomalies resulted from elevated concentrations of radionuclides present in phosphate fertilizers, increased thorium in road-base gravel, and emanations from the radioactive storage site near the Latty Avenue airport.

RESULTS OF MOBILE GAMMA SCANNING ACTIVITIES IN ST. LOUIS, MISSOURI*

INTRODUCTION

From 1942 through approximately 1966, the Mallinckrodt Chemical Works operated four plants in St. Louis, Missouri, for the Manhattan Engineer District (MED) and the Atomic Energy Commission (AEC). In 1954 the contract was transferred to the AEC Oak Ridge Operations and remained there until 1966 at which time the contract was terminated.¹ The facilities were shut down for decontamination in 1957 after which some of the operations were resumed until the contract ended. A variety of production processes using uranium- and radium-bearing ore materials were performed at the plants. Operations included the production, conversion, extraction, concentration, purification, and reworking of uranium compounds; the machining, casting and recasting of uranium metal; and the recovery of scrap uranium metal. Thorium-230 was extracted and concentrated from pitchblende raffinate, and ²²⁶Ra and its daughters were extracted from ore. Process wastes and residues resulting from the operations were transported from the plants for storage at a government site near the Lambert-St. Louis International Airport (SLAPS).

It is the policy of the U.S. Department of Energy (DOE) to verify that radiological conditions at such sites or facilities comply with current DOE guidelines. If they are found to significantly exceed those guidelines, remedial action may be implemented (where DOE has the authority to do so) to correct the unacceptable condition. Subsequent to original assessments and the release of these facilities, guidelines for release and use of such sites have become more stringent as research has provided more information since previous cleanups. Furthermore, documentation is sometimes limited or nonexistent, and release conditions at a specific site may be unknown. DOE established the Formerly Utilized Sites Remedial Action Program (FUSRAP) as part of the effort to confirm the closeout status of facilities under contract to agencies preceding DOE during early nuclear energy development.

The Mallinckrodt plants, vicinity properties, and some haul roads in St. Louis have been previously investigated under FUSRAP to determine the extent of on-site radiological contamination.¹⁻⁶ As a follow-up to earlier investigations and as a precaution to insure that no residual radioactive materials were conveyed to other off-site areas, DOE requested that ORNL conduct an additional survey in the vicinity of the SLAPS and the Mallinckrodt plant (Fig. 1). The survey was restricted to public roadways and to suspected haul routes used when wastes were transferred from the Hazelwood Interim Storage Site (HISS) at 9200 Latty Avenue to West Lake Landfill, and from the Mallinckrodt Plant to the SLAPS. Public roadways and accessible commercial parking areas surrounding the Mallinckrodt site within approximately one-half mile and railroad crossings on the appropriate roads were also scanned (Fig. 2). The purpose of the survey was to assess whether

*The survey was performed by the Measurement applications and Development Group of the Health and Safety Division of Oak Ridge National Laboratory under DOE contract DE-AC05-84OR2100.

any residual radioactive material could be detected along any of the routes. Although several haul routes near the airport storage sites were previously surveyed with the mobile gamma scanning van, selected intersections and/or roads near the airport radioactive storage site were also investigated during this survey. The survey was conducted May 15-17, 1990. Figure 3 shows the haul routes investigated by ORNL in 1990 and 1985, and diagrams the roads characterized by Bechtel National, Inc. (BNI) in 1990.

SURVEY METHODS

A brief description of the methods and instrumentation used for the mobile scanning of the described areas follows. Standard operating procedures for the mobile gamma scanning van were used to conduct the survey.⁷ A more detailed description of the system and operation is provided in Myrick et al.⁸ Anomalies were verified in the system's identification mode. The scoping approach used in this scanning method is described in *Procedures Manual for the ORNL Radiological Survey Activities (RSA) Program*, Oak Ridge National Laboratory, ORNL/TM-8600 (April 1987).⁹

MOBILE SCANNING METHOD

The initial step in searching for gamma radiation anomalies with the scanning van is to obtain the baseline (background) data with which to compare measurements taken in the relevant areas. Background exposure rates were measured along thoroughfares in similar, but radiologically unenhanced regions in the vicinity of the areas of interest. Scans were then performed of the suspect areas at a slow speed (<5 mph), minimizing the distance between the detectors and the properties. All accessible areas were scanned in both directions to maximize the number of views obtained for each surveyed property. Anomaly locations were highlighted by the computer system when the preset "hit" criteria, described as follows, were exceeded during the scan.

INSTRUMENTATION

The gamma radiation detection system employed in the ORNL scanning van is operator-controlled through keyboard instructions to an on-board computer on which data output is displayed. The data can be simultaneously printed and is stored on a dual floppy disk drive. The system consists of three 4 x 4 x 16-in. NaI(Tl) log crystals housed in a lead-shielded steel frame that is mounted on the right side of the van to provide two detector surface areas for acceptance of gamma radiation. A 12 x 16-in. surface measures radiation coming from sources on the right side of the van. The second surface is 4 x 12-in. in size and detects radiation from directly beneath the van. The detector and shield height can be varied with a hydraulic lift mechanism to optimize the detector field-of-view. The detector output is transferred to a computer-controlled eight-channel discriminator and interface that provides for continuous analysis of data inputs for correlation of system location with count rate information. Separate energy regions-of-interest are analyzed and a radionuclide-specific algorithm is employed to identify locations containing residual radium materials. Multichannel analysis capabilities are included in the system for additional qualitative radionuclide identification.

The algorithm used for data analysis compares the observed count rates arising from certain naturally occurring radionuclides to those produced by residual radioactive materials. Three regions of interest for ^{226}Ra (609 keV, 1120 keV, and 1764 keV energy peaks from ^{214}Bi) and one for ^{232}Th (2614 keV from ^{208}Tl) are analyzed. A Ra/Th ratio is computed from the observed background (bkg) observations and this ratio is used for comparison with scan data obtained from the suspect areas. In identifying locations containing residual ^{226}Ra -bearing material, the system utilizes criteria ("hit" criteria) based on the observed background Ra and Th count rates and the computed Ra/Th ratio. The "hit" criteria used are the following:

- (1) a minimum count rate that results in a change in the background Ra/Th ratio;
- (2) an observed Ra/Th ratio that is greater than the background Ra/Th ratio
 $(\text{Ra/Th}_{\text{bkg}} + \sigma_{\text{Ra/Th}_{\text{bkg}}})$; and
- (3) the positive difference between the observed Ra count and the background Ra count
(i.e., the difference = observed Ra - [observed Th $(\text{Ra/Th}_{\text{bkg}} + \sigma_{\text{Ra/Th}_{\text{bkg}}})$]).

A hit is recorded when the first criterion and either the second or third criterion are met.

DETECTOR SENSITIVITY

The sensitivity of the detectors was determined by comparing the detector system response to its position at various distances from a point ^{226}Ra source and to different concentrations of ^{226}Ra in surface soil.⁹ Exposure rates versus distance for these particular sources were well documented. The 1.0 mg ^{226}Ra point source, placed at 2 m above the ground surface (detector height), could be statistically detected at a distance of 65 m. This corresponds to an ~2% (0.25 $\mu\text{R/h}$) increase in normal background radiation levels. The sensitivity of the system was also found sufficient to detect 35 pCi/gm of ^{226}Ra in a 23 kg soil sample at ground level at 3 m distance from the detectors. Obviously, ease of detection increases with increase in total area and volume of ^{226}Ra -contaminated soil. However, the instrumentation cannot provide information regarding mass or quantity of contamination. Thus, a "hit" from a large area of elevated radiation levels at some distance from the detector will appear to be the same as a very small spot of highly radioactive material directly beneath the detector. It should be noted that no attempt has been made to establish a calibration factor for the scanning system since, during actual application, several factors are site-dependent. These include the source-to-detector distance, the counting geometry, and the potential for significant shielding caused by structures or buried material between the contamination and the detectors. An additional limitation is the fact that ^{230}Th , an occasional contaminant in wastes resulting from activities such as those under discussion, does not emit gamma radiation in amounts detectable by the type of instrumentation used for scanning. Elevated concentrations of ^{230}Th to a maximum of 3500 pCi/g were found along with ^{226}Ra and ^{238}U in soil samples taken from anomalies discovered during the 1985 ORNL van scan of haul roads.⁵

SURVEY RESULTS

Analysis of the mobile scan data indicated the presence of anomalies at three locations. One of these was found to be due to increased thorium in road-base gravel. All anomalies detected at a fertilizer plant were attributable to the naturally elevated radium and potassium concentrations known to be present in phosphate fertilizers. Other "hits" were associated with the radioactive storage site on Latty Avenue (HISS) as would be expected from earlier surveys. Radioactive contamination along the fenceline surrounding the former storage site, on several private vicinity properties, along a ~4000 ft Latty Avenue construction corridor, and along some haul routes has been previously verified and the results of the investigations published.²⁻⁶ Radiation levels and concentrations of radionuclides in soil samples from anomalous regions are detailed in References 1-6.

SIGNIFICANCE OF FINDINGS

The results of these scanning activities along suspected haul routes in the vicinity of the Mallinckrodt plant revealed no evidence for the presence of radioactive residuals related to past AEC operations. The anomalies detected at three different locations were attributable to ²³²Th-enhanced road-base gravel, phosphate fertilizers, and emanations from the nearby SLAPS.

REFERENCES

1. W. A. Goldsmith et al., *Radiological Survey of the Mallinckrodt Chemical Works, St. Louis, Missouri*, DOE/EV-0005/27, ORNL-5715, Martin Marietta Energy Systems, Inc., Oak Ridge Natl. Lab., December 1981.
2. W. D. Cottrell and R. F. Carrier, *Radiological Survey of Latty Avenue in the Vicinity of the Former Cotter Site, Hazelwood, Berkeley, Missouri (LM001)*, ORNL/TM-10006, Martin Marietta Energy systems, Inc., Oak Ridge Natl. Lab., May 1987.
3. R. F. Carrier and W. D. Cottrell, *Radiological Survey of the Perimeter Fence Line of the Former Cotter Site, Hazelwood, Missouri (LM002)*, ORNL/TM-10007, Martin Marietta Energy Systems, Inc., Oak Ridge Natl. Lab., December 1986.
4. W. D. Cottrell, R. F. Carrier, and C. A. Johnson, *Radiological Survey of Properties in the Vicinity of the Former Cotter Site, Hazelwood/Berkeley, Missouri (LM003)*, ORNL/TM-10008, Martin Marietta Energy Systems, Inc., Oak Ridge Natl. Lab., May 1987.
5. R. W. Doane, *Results of Mobile Gamma Scanning Activities in Berkeley, Bridgeton, and Hazelwood, Missouri*, ORNL/RASA-87/7, Martin Marietta Energy Systems, Inc., Oak Ridge Natl. Lab., June 1985.
6. Bechtel National, Inc., *Radiological Characterization Report for FUSRAP Properties in the St. Louis, Missouri, Area*, DOE/OR/20722-203, Vol.1, Rev.1, August 1990.
7. C. A. Little et al., *Radiological Survey Activities - Uranium Mill Tailings Remedial Action Project Procedures Manual*, Martin Marietta Energy Systems, Inc., Oak Ridge Natl. Lab., ORNL/TM-9902, 1986.
8. T. E. Myrick, M. S. Blair, R. W. Doane, and W. A. Goldsmith, *A Mobile Gamma-Ray Scanning System for Detecting Radiation Anomalies Associated with Ra-226 Bearing Materials*, ORNL/TM-8475, Martin Marietta Energy Systems, Inc., Oak Ridge Natl. Lab., November 1982.
9. T. E. Myrick, B. A. Berven, W. D. Cottrell, W. A. Goldsmith, and F. F. Haywood, *Procedures Manual for the ORNL Radiological Survey Activities (RASA) Program*, ORNL/TM-8600, Martin Marietta Energy Systems, Inc., Oak Ridge Natl. Lab., April 1987.

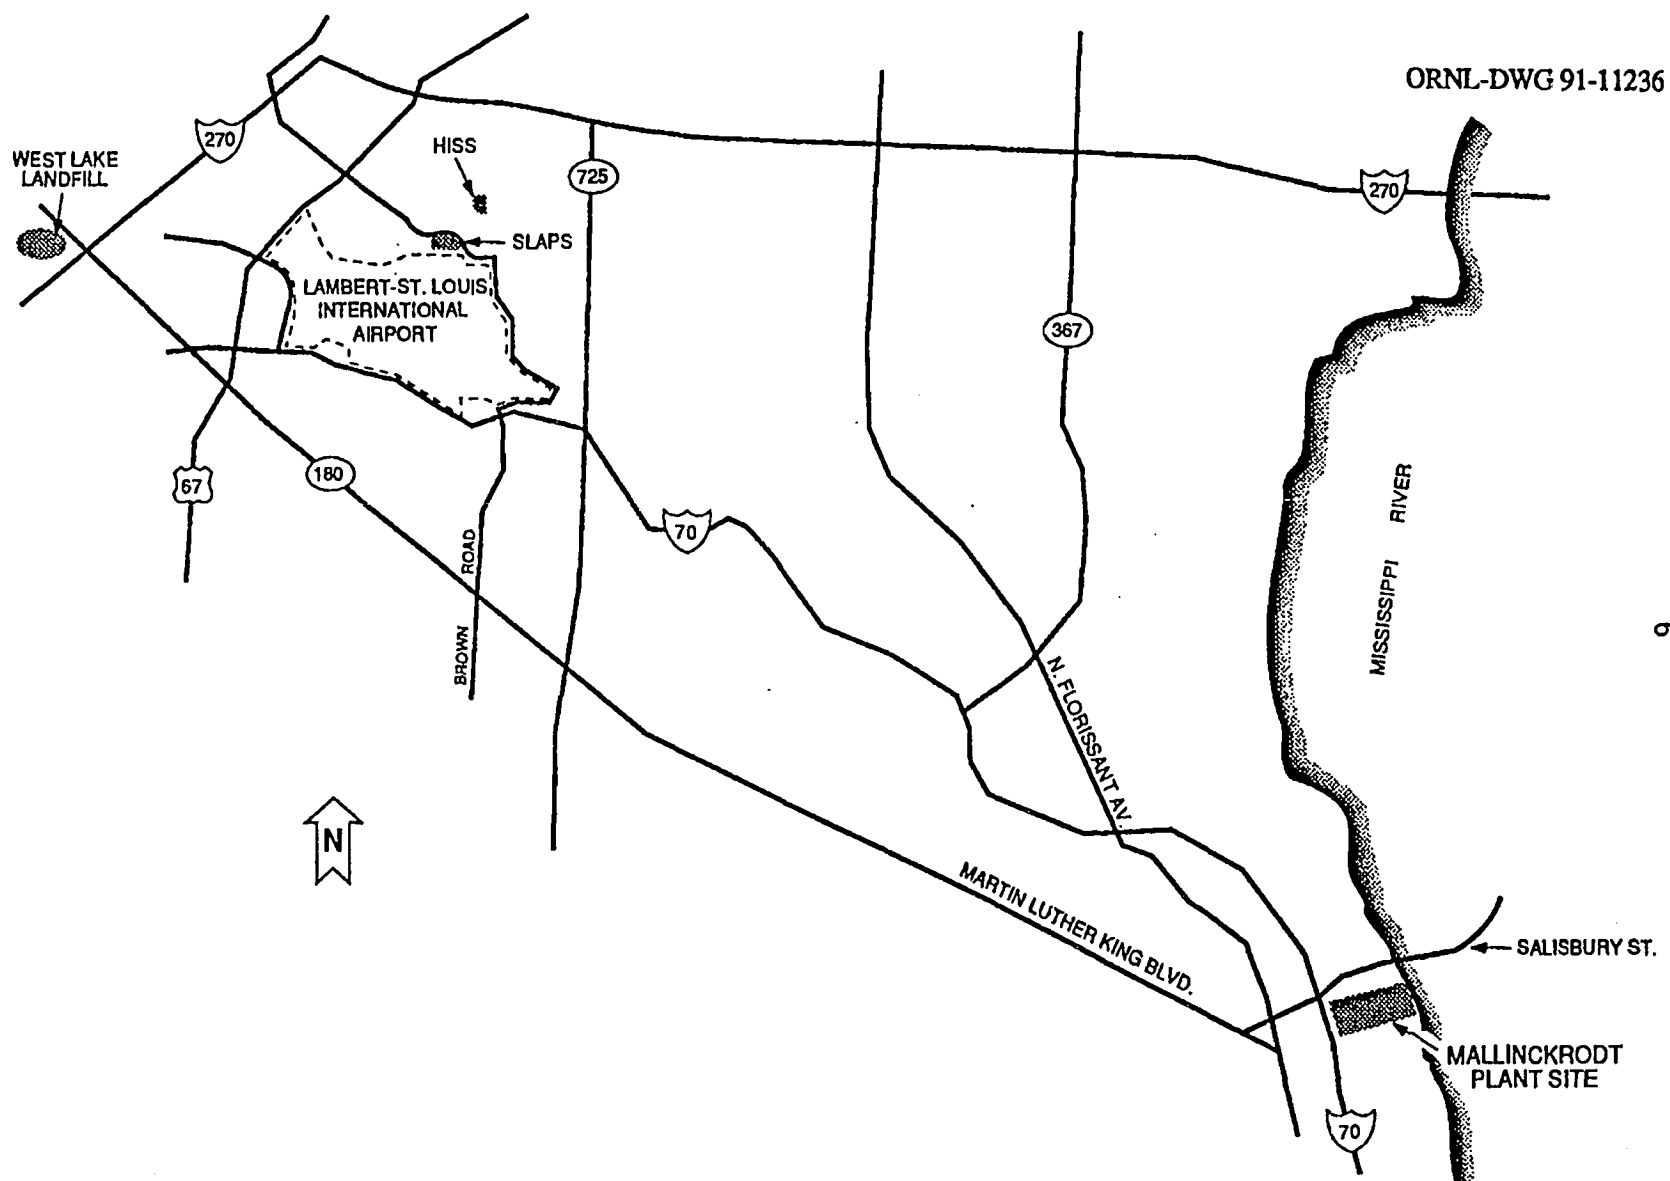


Fig. 1. General location of the Mallinckrodt Chemical Plant and the SLAPS, HISS, and West Lake Landfill storage sites in St. Louis, Missouri.

ORNL-DWG 91-11237

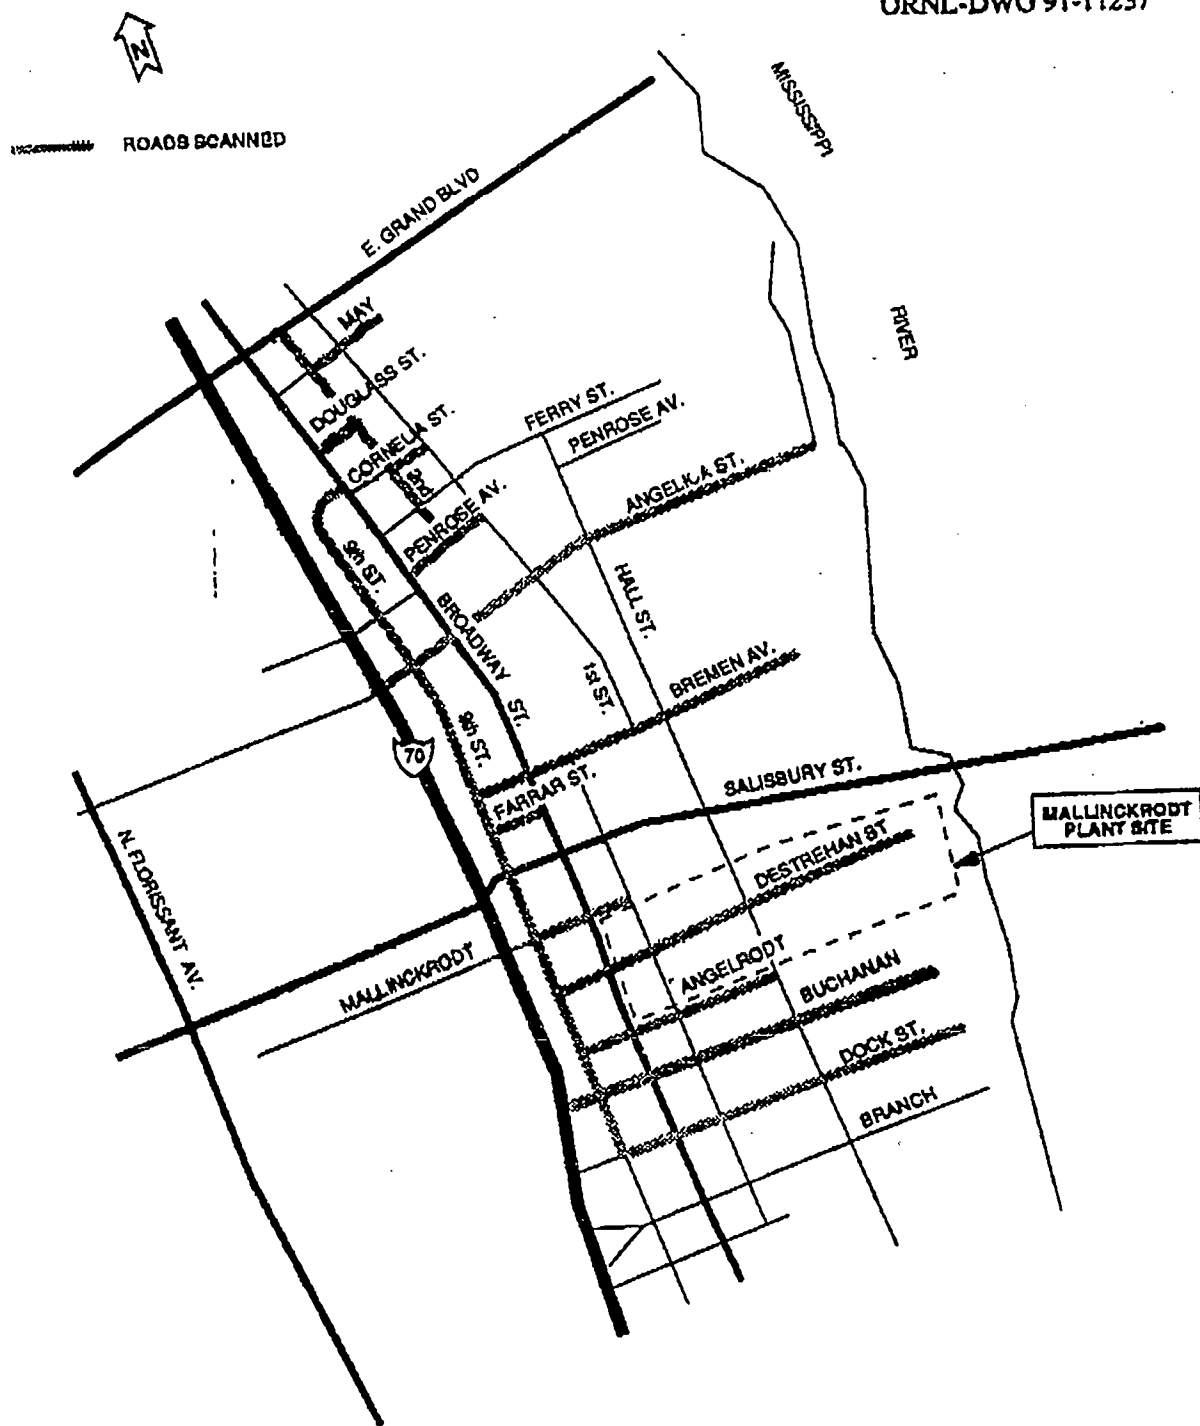


Fig. 2. Diagram of route scanned in the vicinity of the Mallinckrodt Chemical Plant site, St. Louis, Missouri.

ORNL-DWG 91-11238

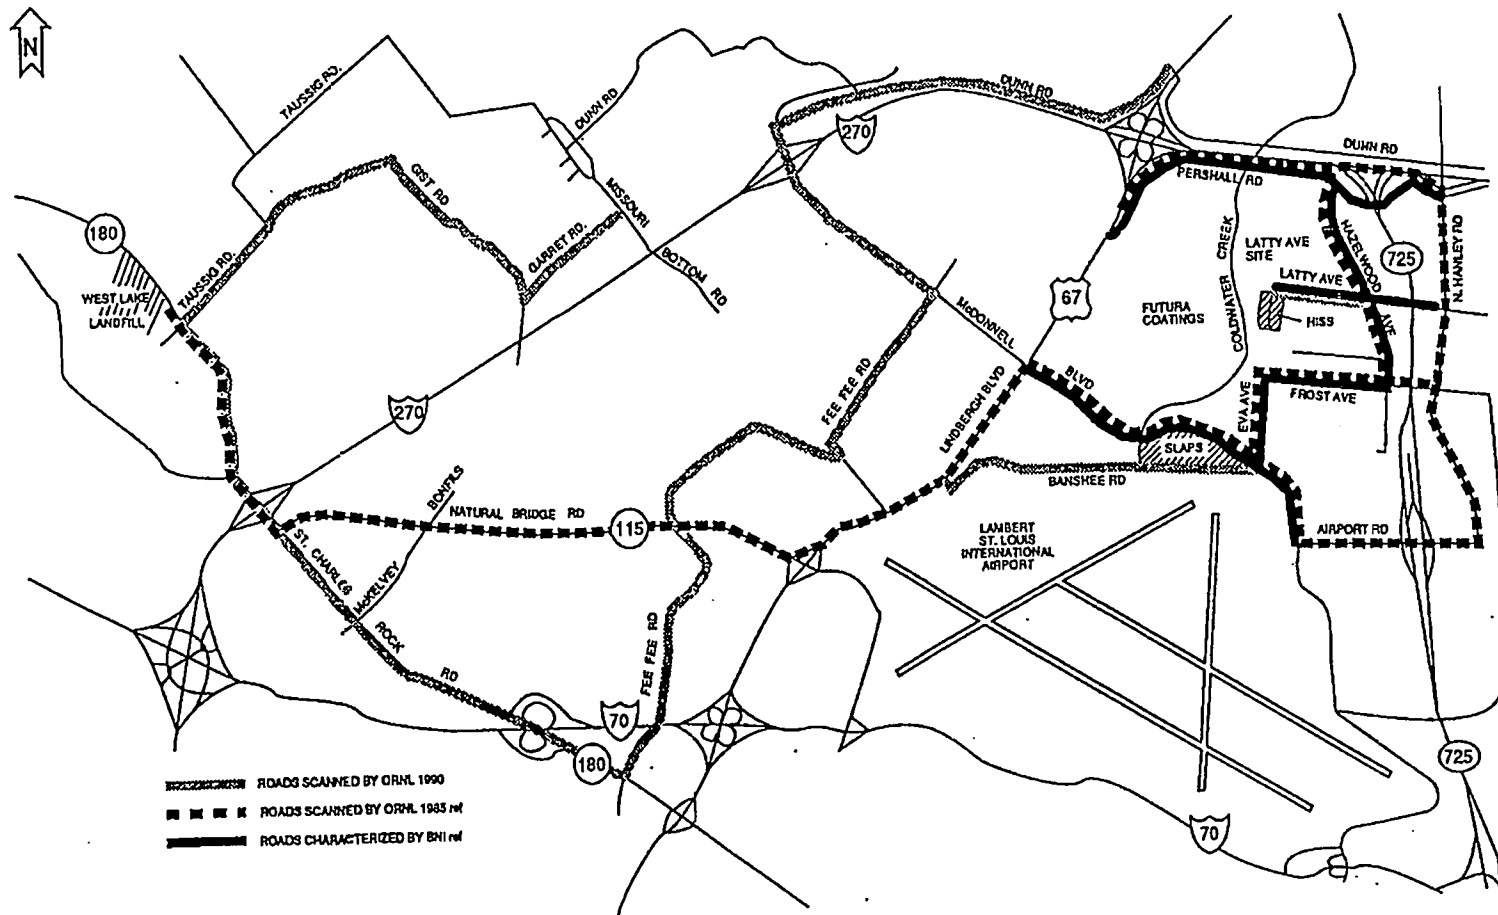


Fig. 3. Diagram of routes scanned by ORNL and routes characterized by BNI in the vicinity of the Lambert-St. Louis International Airport, St. Louis, Missouri.

INTERNAL DISTRIBUTION

- | | |
|-----------------------|--------------------------------|
| 1. B. A. Berven | 15-20. R. E. Rodriguez |
| 2-4. R. F. Carrier | 21. P. S. Rohwer |
| 5-7. W. D. Cottrell | 22-24. R. E. Swaja |
| 8. L. M. Floyd | 25. J. K. Williams |
| 9. R. D. Foley | 26-28. D. A. Witt |
| 10. C. A. Johnson | 29-30. Laboratory Records - RC |
| 11. S. V. Kaye | 31. Central Research Library |
| 12. A. P. Malinauskas | 32. Y-12 Technical Library |
| 13. P. T. Owen | 33-38. MAD Records Center |
| 14. D. A. Roberts | |

EXTERNAL DISTRIBUTION

- 39. J. D. Berger, Oak Ridge Associated Universities, E/SH Division, Environmental Survey and Site Assessment Program, P.O. Box 117, Oak Ridge, TN 37831-0117
- 40. R. W. Doane, TMA/Eberline, 601 Scarboro Road, Oak Ridge, TN 37830
- 41. J. J. Fiore, U.S. Department of Energy, Eastern Division Facility and Site Decommissioning Projects (EM-42), Washington DC 20545
- 42-44. G. K. Hovey, Bechtel National, Inc., FUSRAP Department, P.O. Box 350, Oak Ridge, TN 37831-0350
- 45. L. R. Levis, Office of Technical Services, Weston (Roy F.), Inc., 20030 Century Blvd., Suite 301, Germantown, MD 20874
- 46-48. L. K. Price, U.S. Department of Energy, Oak Ridge Operations Office, Former Sites Restoration Division, P. O. Box 2001, Oak Ridge, TN 37831-8723
- 49. J. W. Wagoner, U.S. Department of Energy, Office of Environmental Restoration & Waste Management, Decontamination and Decommissioning Division (EM-423), Washington DC 20545
- 50. Andrew Wallo III, U. S. Department of Energy, Division of Environmental Guidance (EH-231), Washington, DC 20585
- 51-53. W. Alexander Williams, U.S. Department of Energy, Office of Environmental Restoration & Waste Management, Decontamination and Decommissioning Division (EM-423), Washington DC 20545
- 54. Office of Assistant Manager, Energy Research and Development, U.S. Department of Energy, Oak Ridge Operations Office, P.O. Box 2001, Oak Ridge, TN 37831-8600
- 55-57. Office of Scientific and Technical Information, U.S. Department of Energy, Oak Ridge Operations Office, P.O. Box 62, Oak Ridge, TN 37831

Administrative Record for the Formerly Utilized Sites Remedial Action Program (FUSRAP) North St. Louis County Sites

St. Louis County, Missouri



**US Army Corps
of Engineers**
St. Louis District®

Volume 1.7f
Site Management –
Federal, State, Local technical records

SLAP_000693

Administrative Record for the Formerly Utilized Sites Remedial Action Program (FUSRAP) North St. Louis County Sites

St. Louis County, Missouri



**US Army Corps
of Engineers**
St. Louis District®

Volume 1.7f
Site Management –
Reference Documents

00-1345

Formerly Utilized Sites Remedial Action Program (FUSRAP)

ADMINISTRATIVE RECORD

for the St. Louis Site, Missouri



U.S. Department of Energy

Property
of
ST LOUIS FUSRAP LIBRARY